




MASCO CASTinTACT® DETECTABLE WARNING
2 EACH 2' x 2' PANELS

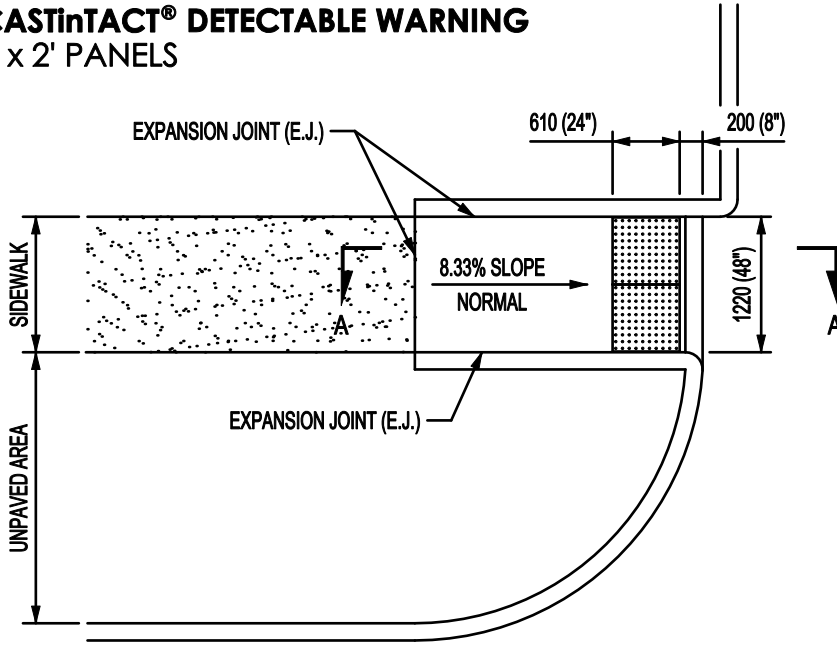

**1220mm (48") PARALLEL SIDEWALK RAMP DETAIL
 OPTION 3**

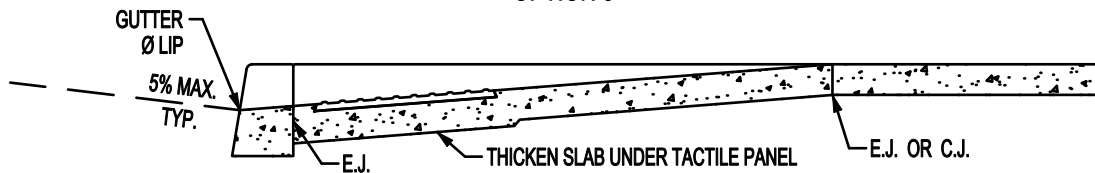

SECTION A-A

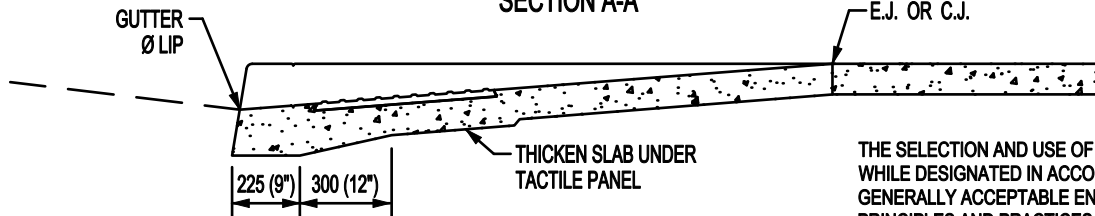

**SECTION A-A
 MONOLITHIC CURB & SIDEWALK**

THE SELECTION AND USE OF THIS DRAWING WHILE DESIGNATED IN ACCORDANCE WITH GENERALLY ACCEPTABLE ENGINEERING PRINCIPLES AND PRACTICES, IS THE SOLE RESPONSIBILITY OF THE USER AND SHOULD NOT BE USED WITHOUT CONSULTING A REGISTERED PROFESSIONAL ENGINEER.

GENERAL NOTES

1. PLACE TRUNCATED DOME DETECTABLE WARNING PANELS AT THE BASE OF CURB RAMP. INSTALL ACROSS FULL WIDTH OF RAMP A MINIMUM 610mm (24") IN DEPTH AND SET BACK 200mm (8") FROM BOTTOM OF CURB.
2. SIDEWALK CURB RAMP SLOPES SHOWN ARE RELATIVE TO THE TRUE LEVEL HORIZON (ZERO BUBBLE).
3. IN ALTERATIONS CURB RAMP SLOPE(S) MAY BE 10% FOR A MAXIMUM RISE OF 150mm (6") OR 12.5% FOR A MAXIMUM RISE OF 75mm (3"). CURB RAMPS, IN ALTERATIONS, NEED NOT EXCEED 1.8m (6'-0") IN LENGTH.
4. SIDE FLARES THAT ARE NOT PART OF THE PATH OF TRAVEL MAY BE ANY SLOPE.
5. FOR THE PURPOSES OF THIS DRAWING, A CURB RAMP IS CONSIDERED "PERPENDICULAR" IF THE ANGLE BETWEEN THE LONGITUDINAL AXIS OF THE RAMP AND A TANGENT TO THE CURB AT THE RAMP CENTER IS 75 DEGREES OR GREATER.
6. JOINTS ARE REQUIRED AT ALL SIDEWALK RAMP SLOPE BREAKS. EXPANSION JOINTS ARE RECOMMENDED BETWEEN EXISTING CONCRETE AND NEW CONCRETE WHERE APPLICABLE. (REFER TO ACI 360R)
7. SIDEWALK FLARE IS NOT NECESSARY WHERE THE RAMP IS PROTECTED FROM PEDESRIAN CROSS TRAVEL.
8. THICKEN CONCRETE UNDER DETECTABLE WARNING PANEL.
9. IN EXTREME CLIMATES LEAVE 3/16" GAP BETWEEN SQUARE CUT PANEL JOINTS AND SEAL WITH COMPATIBLE ELASTOMERIC SEALANT.

E.J. = EXPANSION JOINT
 C.J. = CONTROL JOINT

For more information please visit

CASTinTACT.com

