



OPTION 1



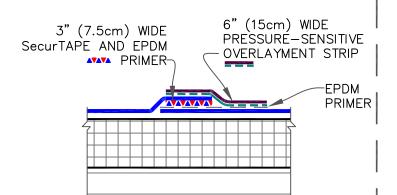

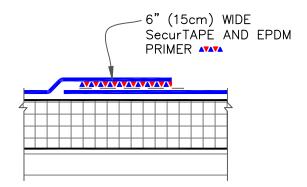

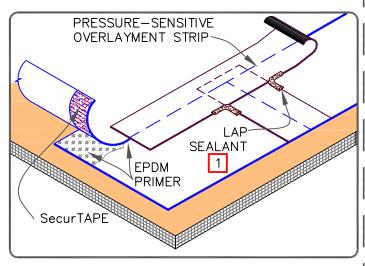

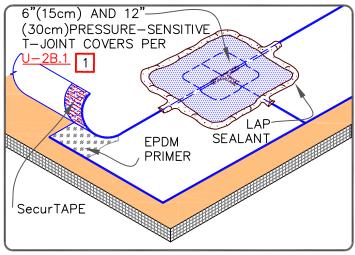

F.A.T. (FACTORY APPLIED SecurTAPE)

NOTES:

- 1. APPLY LAP SEALANT AT ALL INTERSECTIONS BETWEEN PRESSURE—SENSITIVE OVERLAYMENT STRIP.
- 2. REFER TO DETAIL MF-2A.1 FOR MECHANICALLY-FASTENED SPLICES.

NOTE:

1. APPLY LAP SEALANT ALONG THE EXPOSED EDGE OF THE MEMBRANE SPLICE COVERING THE EXPOSED SPLICE TAPE 1/2" (1.5cm) IN EACH DIRECTION FROM THE SPLICE INTERSECTION AND OVERLAY WITH A 6" (15cm) T-JOINT COVER. INSTALL A 12" (30cm) T-JOINT COVER CENTERED OVER THE FIRST T-JOINT COVER PER DETAIL U-2B.1.



EPDM MEMBRANE SPLICE (25/30 YEAR WARRANTIES)

MAXIMUM WARRANTY: 30 YEARS



DETAIL NO.

THERMOSET UNIVERSAL