

## WESTERN ELECTRO - ACOUSTIC LABORATORY

A division of Veneklasen Associates, Inc.

TESTING • CALIBRATION • RESEARCH

25132 Rye Canyon Loop Santa Clarita, California 91355 Tel: (661) 775-3741 Fax: (661) 775-3742 www.weal.com

### SOUND TRANSMISSION LOSS TEST REPORT NO. TL12-319

CLIENT:

Amsco

1880 South 1045 West

12 June 2012

Page 1 of 2

P.O. Box 25368

Salt Lake City, UT 84125

TEST DATE: 16 May 2012

#### INTRODUCTION

The methods and procedures used for each test conform to the provisions and requirements of ASTM E 90-09, Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and ASTM E2235-04<sup>£1</sup>, Standard Test Method for Determination of Decay Rates for Use in Sound Insulation Test Methods. Copies of the test standard are available at <a href="www.astm.org">www.astm.org</a>. The test chamber source and receiving room volumes are 204 and 148.4 cubic meters respectively. Western Electro-Acoustic Laboratory is accredited by the United States Department of Commerce, National Institute of Standards and Technology under the National Voluntary Accreditation Program (NVLAP) Lab Code 100256-0 for this test procedure. This test report relates only to the item(s) tested. This report must not be used to claim product certification, approval, or endorsement by WEAL, NVLAP, NIST or any agency of the federal government.

#### **DESCRIPTION OF TEST SPECIMEN**

The test specimen was an Amsco V91 Series vinyl picture window assembly. The specimen was installed by screwing the nailing fin around the entire perimeter to the wood edge of the test chamber opening. The assembly was sealed into the test chamber opening with latex caulking under the nailing fin and a heavy duct seal putty around the entire perimeter on the receiving room side. The glazing consisted of a 25.4 mm (1 inch) dual glazed unit which was 3 mm (1/8 inch) double strength glass, 17.4 mm (11/16 inch) air space, and 5 mm (3/16 inch) monolithic glass. The unit was glazed into the frame using glazing tape and vinyl snap in bead. The net outside frame dimensions of the window assembly were 1.82 m (71-1/2 inches) wide by 1.21 m (47-1/2 inches) high by 66.7 mm (2-5/8 inches) deep. The overall weight of the assembly was 45.4 kg (100 lbs.) for a calculated surface density of 20.7 kg/m² (4.24 lbs./ft²).

#### **RESULTS OF THE MEASUREMENTS**

One-third octave band sound transmission loss values are plotted and tabulated on the attached sheet. ASTM minimum volume requirements are met at 80 Hz and above. The Outdoor-Indoor Transmission Class rating determined in accordance with ASTM E 1332-90(2003) was OITC-26. The Sound Transmission Class rating determined in accordance with ASTM E 413-04 was STC-33.

Approved:

Gary E. Mange Laboratory Director Respectfully submitted,


Western Electro-Acoustic Laboratory

Raul Martinez

Acoustical Test Technician

# WESTERN ELECTRO-ACOUSTIC LABORATORY

Report No. TL12-319

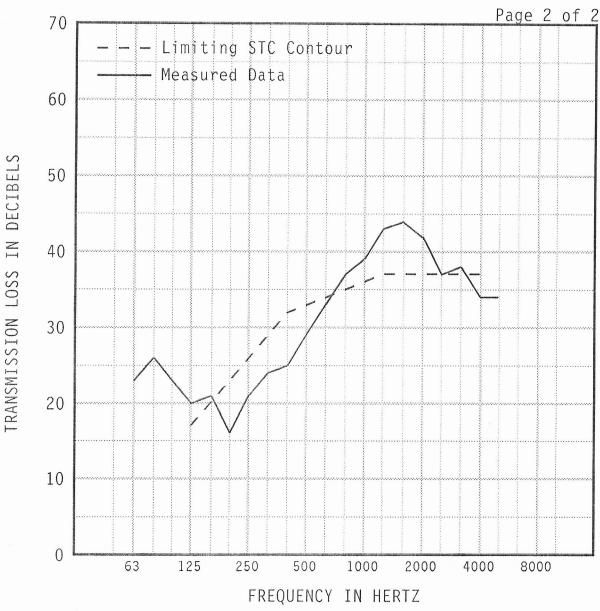

1/3 OCT BND CI	NTR FREQ	63	80	100	125	160	200	250	315	400	500
TL in dB 95% Confidence deficiencies		*23 1.42	26 1.92	23 2.07	20 1.47	0.89	16 0.76 (7)	21 0.80 (5)	24 0.52 (5)		29 0.38 (4)
1/3 OCT BND CI	NTR FREQ	630	800	1000	1250	1600	2000	2500	3150	4000	5000
TL in dB 95% Confidence deficiencies		33 0.29 (1)	37 0.44	39 0.38	43	0.36	42 0.56	37 0.55 (0)	38 0.31	34 0.32 (3)	34
EWR OITC  * Minimum estimate of transmission loss. Measurement limited by filler wall. Actual TL will be equal to or greater than value reported.  * Minimum estimate of transmission loss. Specimen Area: 23.59 sq.ft.  Temperature: 73.4 deg. F Relative Humidity: 40 %											STC 33 (32)
than value reported. Tost Dato: 16 May 2012											

Report must be distributed in its entirety except with written authorization from Western Electro-Acoustic Laboratory

